Sleepy Hollow Park

Side by Hollow Park is small heighborhood park that provides two pichic tables, a gnil and trash can. The main issues at this park are that it is mostly undeveloped and does not provide an accessible route to the picnic tables and grill provided. A single route could be provided to each of these features or if developed further provide tables and an a grill closer to the street/sidewalk entrance. **Please Note**: When a **UD** is indicated, this is a Universal Design **(UD)** recommendation to enhance accessibility. The **UD** recommendation is not required to meet the minimum accessibility standards but it would be encouraged.

The report uses two different accessibility codes. The Americans with Disabilities Act Accessibility Guidelines (ADAAG) can be down loaded from the Access Board website. The website is www.access-board.gov. In addition, the Illinois Accessibility Code (IAC) was also used in this report. This code can be down loaded from the website, www.cbd.state.il.us/IAC.

The park district is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

PLEASE NOTE: Any references for Outdoor Developed Areas is presently not approved by the Department of Justice. However, it would be recommended to follow these standards as "Best Practices" at this point in time. In addition, in existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information. ADAAG 206.2 requires that at least one accessible route be provided within the boundary of the site. The reports provide comments on all routes that when upgrades are made in the future modifications can be made to correct the access barrier or in some cases modify to the greatest extent possible.

Photo	Barrier	ADAAG/IAC	Solution	Priorit y	By Whom	Projected Cost	Projected Date	Action Taken
	There is no accessible route to the picnic area for 262'.	ADAAG 403.3	Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36".			\$8,650.00	2021	

Sleepy Hollow Park

ACTServices, Inc. Accessibility Consultation and Training Services

Photo	Barrier	ADAAG/IAC	Solution	Priorit y	By Whom	Projected Cost	Projected Date	Action Taken
	There is one trash can provided but it is not on an accessible route for 262'.	Proposed Outdoor Developed Areas Guidelines 1011	Trash Can Recommendation: Locate trash cans on an accessible route as part of your regular policy. For a forward approach provide a trash can within 24" and a minimum clear ground space of 36" by 48" or for a side approach provide a trash can within 24" and a minimum clear ground space of 30" by 60".			\$50	2021	
	There are two picnic tables provided but none are of the accessible design or on an accessible route for 262'.	Proposed Outdoor Developed Areas Guidelines ADAAG 245 & 1011	Picnic Table Recommendation: At least 20% of picnic tables, but no less than two, be of accessible design, connected to an accessible route. Relocate or purchase two accessible picnic tables. An accessible surface is already provided.			\$1,650	2021	

Sleepy Hollow Park

ACTServices, Inc. Accessibility Consultation and Training Services

Image: Second	Photo I	Barrier	ADAAG/IAC	Solution	Priorit y	By Whom	Projected Cost	Projected Date	Action Taken
	provided 36" to the surface. an acce	d but there is ne cooking . It is not on essible route	Proposed Outdoor Developed Areas Guidelines ADAAG 1011.5	Follow Outdoor Developed Area Report that states 20% of grills, but at least two, be of accessible design, and connected to an accessible route. The accessible grill should provide a cooking surface a minimum of 15" to 34" maximum AFF above the ground surface, a clear floor space and controls that are within a maximum reach range of 48" AFF. And a 48" by 48" space centered on the usable sides of the grill is			\$400	2021	